

3611 IRVING BLVD DALLAS, TX 75247 P: (214) 631-4770 www.brucknertruck.com

BILL TO

WARRANTY - MACK - &WMK

00000

P: F: SHIP TO

BRZ - 263435 6850 W 63RD ST CHICAGO IL 60638 P: (123) 456-7890

F:

SERVICE ORDER: RA110026361

	DATE ARRIVED DATE INVOICE		SALES TYPE	ADVISOR		TERMS	CUSTOMER PO#	
3/19/2	2025 1:42:00PM		SWM	A. Ruiz		INT		
YE	AR MAKE	MODEL	VIN	CUSTOMER UNIT #	ENGINE HOURS	IN SERVICE	Component Serial #	ODOMETER
202	23 MACK	AN64T	1M1AN4GY2PM031939	857	14,210			408301

Sold Operations

JOB #1 600 SERVICE - GENERAL CAB REPAIR

COMPLAINT

C/S WIPERS GET STUCK. C/A - customer suspects wiper motor

CAUSE

CORRECTION

2542 - INSPECTED FOR WIPERS GETTING STUCK, ATTEMPTED TO OPERATE WIPERS AND THEY DID A SMALL JUMP BUT THEN DID NOT MOVE ANYMORE. OPERATED AGAIN AND WENT UNDER HOOD TO INSPECT, CAN HEAR MOTOR TURNING AND WIPERS WILL INTERMITTENTLY CATCH AND MOVE. DISCONNECTED WASHER LINES, REMOVED WIPER ARMS AND PULLED RAIN TRAY. DISCONNECTED WIPER MOTOR AND CITY HORN THEN REMOVED WIPER MOTOR BRACKET. TRANSMISSION ARM FELL OFF THE END OF THE MOTOR WHEN BRACKET WAS PULLED, INSPECTED AND FOUND SPLINES ON MOTOR AND SPLINES ON WIPER TRANSMISSION ARM ARE BOTH STRIPPED OUT. REMOVED TRANSMISSION ARM ASSEMBLY AND INSTALLED NEW ASSEMBLY. INSTALLED NEW MOTOR ONTO BRACKET AND THEN INSTALLED TRANSMISSION ARM ONTO MOTOR. INSTALLED TRANSMISSION ARM ROD THROUGH BUSHINGS AND INSTALLED CLIP ON END OF ROD. INSTALLED WIPER MOTOR BRACKET AND CITY HORN THEN RECONNECVTED CONNECTORS. REINSTALLED RAIN TRAY AND OPERATED WIPERS TO ENSURE MOTOR IS AT REST POSITION. INSTALLED WIPER ARMS AND VERIFIED PROPER OPERATION. LINE COMPLETE - 2542

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
3	110M/25107341	FLANGE SCREW		
1	110M/78746827	WIPER MOTOR		
1	110M/82277591	BRACKET		
1	110M/84716580	WIPER MECHANISM		
	LABOR 1700-16-03-01	Diagnostic Time		
	LABOR 3631-03-02-06	Windshield Wiper Transmission, Replacement		

JOB #2 100 SERVICE - GENERAL REPAIR

COMPLAINT CAUSE

C0400 SC0472 - Bendix ABS ECU -

CORRECTION

2542 - UPDATED EC-80 SOFTWARE PER CAMPAIGN INSTRUCTIONS. CLEARED FAULTS CAUSED BY

PROGRAMMING. LINE COMPLETE - 2542

Ш	QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
Ш		LABOR 100	C0400 SC0472 - Bendix ABS ECU		

SERVICE ORDER: RA110026361

ESTIMATE: 19415049

DISCLAIMER OF WARRANTIES

ANY WARRANTIES ON THE PRODUCTS SOLD HEREBY ARE THOSE MADE BY MANUFACTURER, IF ANY. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES EITHER EXPRESS OR IMPLIED. INCLUDING ANY IMPLIED WARRANTY OR MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE AND BRUCKNER TRUCK SALES, INC., NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF SAID PRODUCTS. WE HEREBY CERTIFY THAT THESE GOODS WERE PRODUCED IN COMPLIANCE WITH ALL APPLICABLE REQUIREMENTS OF SECTIONS 6, 7, AND 12 OF THE FAIR LABOR STANDARDS ACT OF 1938. AS AMENDED AND OF REGULATIONS AND ORDERS OF THE ADMINISTRATOR OR WAGE AND HOUR DIVISION ISSUED UNDER SECTION 14 THEREOF.

AUTHORIZED BY	DATE	

NOT AN INVOICE