



TOTAL TRUCK CARE

LOVE'S
0820 Tyre, NY SPEEDCO
1262 Route 414 Waterloo, NY 13165
(315) 835-7244

WORK ORDER #: 4001046476
WORK ORDER DATE: 06/30/2023
CLOSE DATE:
SERVICE TYPE: In Shop

SHIP TO: England Carrier Services(3408710)
PO BOX 27566
Salt Lake City, UT 84127-0566
(801) 974-3520

SOLD TO: England Carrier Services(34087
PO BOX 27566
Salt Lake City, UT 84127-0566

BILL TO: ENGLAND CARRIER SERVICES (STK/
4701 W 2100 S
SALT LAKE CITY, UT 84120
ACCOUNT #: 1268394

<input checked="" type="checkbox"/> TRACTOR #	VIN #	YEAR	MAKE	MILEAGE	PLATE#/STATE	ENGINE
715	1FUJHHDR2MLMP3397	2022	OTHER		ASK DRIVER/IL	OTHER
<input type="checkbox"/> TRAILER #	VIN #	YEAR	MAKE	HUBOMETER	PLATE#/STATE	REEFER #
APU# / HOURS	ADDITIONAL UNIT	START TIME	END TIME	DRIVER NAME	DRIVER CONTACT	
				Abdirahman	469-271-3003	
Authorization #	AUTHORIZATION NAME	PAY TYPE	PO#	PO ISSUED BY	DR#	
3000067110	Ben Widup	NAB Michelin			DR0080500	

COMPLAINT:

My carreier Abdirahman with BRZ is needing 1 Michelin XDN2 drive tire. Please give me a call if you have any questions 801-656-4699.

DESCRIPTION	MECHANIC	UOM	QUANTITY	LIST PRICE	PRODUCT	LABOR	EXTENSION
Tire Replacement		EA	1.00	0.00	0.00	0.00	0.00
M63465 275/80R22.5G XDN2		EA	1.00	0.00	0.00	0.00	0.00
FET							0.00
INSIDE TIRE CHARGE		EA	1.00	0.00	0.00	0.00	0.00
TIRE DISPOSAL		EA	1.00	0.00	0.00	0.00	0.00
DISMOUNT AND MOUNT MED TRUCK TIRE		EA	1.00	0.00	0.00	0.00	0.00

Unit :TRACTOR Old Brand :MICHELIN Position :LRI Failure Reason :Blown Old Tread Depth :0 Old DOT# :12345678 New DOT# :13LEJ0B5X3822

Parts	0.00
Labor	0.00
Tires	0.00
Fees	0.00
Customer Discount*	0.00
Site Discount	0.00



21568 HIGHVIEW AVE
LAKEVILLE, MN 55044-7575
PHONE: (952) 854-5511

FAX: (952) 854-2999
www.istatetruck.com

ACCOUNT NUMBER: &WIPSMSC
INVOICE NUMBER: R001203671
INVOICE DATE:
INVOICE TERMS: NET30

VEHICLE#: 797149

SERVICE ORDER

BILL-TO

IPS WARRANTY- MISCELLANEOUS
MINNEAPOLIS, MN 55425

SHIP-TO

ROYAL 3 INC
6850 65TH ST
BEDFORD PARK, IL 60638-1710

Cust. Unit #: 756	Make: FREIGHTLINER	Model: PT126SLP	Tag #: WT
VIN: 3AKJHHFG9NSNM4001	Model #: PT126064S	In Serv Date: 05/06/2022	Year: 2022
Engine S/N: 80387503	Model #: X15	In Serv Date:	Mileage: 230,001
Tran S/N: Z0207520	Model #: EEO-16F112C	In Serv Date:	Eng Hrs: 0
Reefer S/N:	Model #:	In Serv Date:	Warr ID:
APU S/N:	APU Gen S/N:	In Serv Date:	Date Create: 10/30/2023
Rep Eng S/N:		BOM/Spec:	

Warranties: All warranties on the products sold hereby are those made by the manufacturer. Seller hereby expressly disclaims all other warranties, express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law. Authorization: You are hereby authorized to undertake the above repairs along with the necessary materials. I understand that full payment is due upon release of the vehicle, including any supplemental charges and an express lien attaches to the vehicle to secure amount of repairs thereto. I agree to the General Terms and Conditions of Sale set forth on the Invoice. Your employees may operate above vehicle for testing, inspection, or delivery at my risk. It is also understood that you will not be held responsible for loss or damage to vehicles or articles left in vehicles in case of fire, theft or any other cause beyond your control.

Preliminary Estimate \$ _____

Authorized By X _____ Date _____ ☐ Verbal

Customer Repair and Delivery Acceptance

Acceptance X _____ Date _____

Mon-23-2023 03:10:05 PM - BROUGHT UNIT INTO SHOP AND HOOKED UP TO UNIT WITH SERVICE RANGER, PULLED CODES AND BEGAN TROUBLE SHOOTING TROUBLE SHOOTING TOLD ME TO CLEAR CODES AND SEE WHICH CODES COME BACK, AFTER CLEARING CODES AND STARTING UNIT FOUND UNIT HAD 1 NEW CODE, TROUBLE SHOT CODE AND IT SAID THE SAME THING, STARTED A SERVICE REPORT AND FORMAN WILL CALL EATON,

Tue-24-2023 08:59:28 AM - TALKED WITH EATON THIS MORNING AND WAS TOLD TO REPLACE CLUTCH AND DIAG ABS CODES, FORMAN GOT WITH PARTS AND GOT NEW CLUTCH COMING AND WAITING ON DEAL CODE TO PERFORM WARRANTY,

Wed-25-2023 02:35:35 PM - Remove drivers side steps and plastic, Disconnect batteries, pulled electric floor jacks over into place and under front wheels, raised front end of truck, loosened all drive line bolts and hanger bearing bolts and placed drive shaft aside, loosened multiple brackets on top of transmission, disconnected harnesses to transmission and placed aside, found trans, jack in tool room and secured to bottom of transmission with blocks of wood and tie down strap, removed all bell housing bolts and set aside, carefully split transmission from block and lowered to floor, pulled transmission out from under truck for inspection, found transmission clutch removal and install jack and removed pressure plate and clutch disc to the floor, removed all flywheel bolts and removed flywheel from engine to be sent out to the machine shop, while inspecting clutch assy, found pressure plate fingers missing, throw out bearing seized, clutch disc. burnt and cpa damaged, informed Forman and waiting for direction to continue

Thu-26-2023 02:30:16 PM - Prepped flywheel and pressed pilot bearing into place, prepped new flywheel bolts and applied oil to threads, placed aligning pins in crankshaft and lifted flywheel into place, tightened all bolts then torqued flywheel bolts to 185 ft lbs, removed old throw out bearing and installed with new, removed old pilot bushing from shaft and installed with new, waiting on CPA to arrive and clutch plate alignment tool to continue

Fri-27-2023 04:12:37 PM - prepped flywheel and pressure plate, following instructions installed alignment pins, installed clutch plate with alignment tool, lifted and installed pressure plate, torqued