



ABILENE, TX	ALBUQUERQUE, NM	BRYAN, TX	CALVERT CITY, KY
EL DORADO, AR	FARMINGTON, MO	FARMINGTON, NM	JACKSON, MO
JACKSON, TN	JONESBORO, AR	MEMPHIS, TN	PARIS, TX
POPLAR BLUFF, MO	SAN ANGELO, TX	SHREVEPORT, LA	SIKESTON, MO
SPRINGFIELD, MO	TEMPLE, TX	TEXARKANA, TX	TYLER, TX
TUPELO, MS	WACO, TX	WICHITA FALLS, TX)

Albuquerque Freightliner

12901 US HWY. 66 W FRONTAGE RD ALBUQUERQUE, NM 87121

Bill-To Customer: CASH-200

ZIGI FREIGHT/ROYAL 3 ALBUQUERQUE NM 87121

R200025294:01

INVOICE DATE

SERVICE INVOICE

1/8/2025

Owner: CASH-200

ZIGI FREIGHT/ROYAL 3 ALBUQUERQUE NM 87121

Customer Phone: (630) 566-1407

DAT	TE ARRIVED	SALES TYPE	TERMS	ID	ADVISOR	CUSTOMER PO	DA	TE INVOICE
1/6/2025 12:	:03PM	SCC	COD	MSMZ5505	KEVIN			1/8/2025
YEAR	MAKE	MODEL		VIN	CUSTOMER UNIT #	IN SERVICE	ODOM IN	ODOM OUT
2021	FTL	PT126SLP		3AKJHHDR6MSMZ550	5 723	03/22/2021	471,761	471,761
Sold Operations								
JOB #1 EA-DET EXPRESS DETROIT ENGINE COMPLA SERVICE - IBS								
COMPLAINT EXPRESS DETROIT ENGINE COMPLAINT ** CEL,MIL ARE ON. CAUSE								
	CORRECTION HOOKED UP COMPUTER. HAVE FAULTS 521049/31, 521052/31 DEF INDUCEMENT. I BROUGHT							
THE TRUCK INTO THE SHOP AND WENT THREW THE TROUBLESHOOTING FOR 521049/31								
		DEF INDUCEMEN	NT DEF I	AMP ACTIVE. THAT	CODE SENT ME TO 4364	4/17 SCR NOX		
		CONVERSION EF	FFICIENC	CY LOW DETECTION	BY MOVING AVERAGE	WITH NINE COUN	TS.I	
		HAD TO UPDATE	E ALL TH	E POWER MODULES	UP TO THE HIGHEST SO	OFTWARE. CPC		
		R19.32.00.00A= R	21.42.00.	00A, MCM 6.8.0.1= 6.9	.0.2, TCM NAMT191402=	= NAMT201403 AN	D THE	
		ACM 7.61.1.0= 7.6	51.2.0. AL	L CODES CLEARED	THE SCREEN BUT THE I	NDUCEMENT LAN	MPS.	
		UNIT WILL NEED	O A REGE	EN/SCR EFFICIENCY	TEST TO COMPLETE TH	E TROUBLESHOO	TING	
AND CLEAR THE INDUCEMENT LAMPS. UNIT IS NOW GOING THREW THE REGEN/SCR								
	\mathbf{P}				D UNIT FAILED WITH A			
- 3216/20 SCR NOX INLET SENSOR DRIFT HIGH. I WENT THREW THE TROUBLESHOOTING AND								
RAN A NOX VERIFICATION. UNIT FAILED THE TEST. WE WILL HAVE TO REPLACE THE INLET								
NOX SENSOR AND CONTINUE WITH THE TROUBLESHOOTING. I RECOMMEND TO REPLACE								
THE OUTLET NOX SENSOR. P&A IS TURNED IN FOR REPAIR.								
I REPLACED THE INLET AND THE OUTLET NOX SENSOR. UNIT IS NOW GOING THREW THE								
REGEN/SCR EFFICIENCY TEST.UNIT COMPLETED THE REGEN/SCR EFFICIENCY TEST. I								
QTY	ITEM	CLEARED ALL C		IPTION		UNIT PRICE		EXTD PRICE
	SOFTW			ology Charge				50.00
	LABOR			ology churge				1,520.00
	200D/DDE RA	.0101531928	NOX	SENSOR HDEP 1BOX GHO	17 INL	378.89		378.89
	200D/DDE RA			SENSOR HDEP/MDEG GH		378.89		378.89
	200X/NPA 770			E WRAP BLK		0.92		9.20
-		.0101531928-CORE		SENSOR HDEP 1BOX GHO	1-CORE	120.00		-120.00
		.0101538128-CORE		SENSOR HDEP/MDEG GH		120.00		-120.00
		.0101531928-CORE		SENSOR HDEP 1BOX GHO		120.00		120.00
		.0101538128-CORE		SENSOR HDEP/MDEG GH		120.00		120.00
		0101000120-CORL	ΠΟΛ		por: \$1,520.00 Misc: \$50]		\$2,336.98



SERVICE INVOICE: R200025294:01 REFERENCE: E200022057

Page 2 of 2

Albuquerque Freightliner 12901 US HWY. 66 W FRONTAGE RD ALBUQUERQUE, NM 87121

Sold Operations (Cont.)

EFFECTIVE: 11/16/14 - CLOSED ON SUNDAYS NOW AVAIL: 24/7 AFTER HRS CALL OUT - PARTS OR SERV

TERMS AND CONDITIONS OF SALE AND DISCLAIMER OF WARRANTIES

 <u>Disclaimer for Labor</u>. Seller disclaims all warranties, either express or implied, for labor performed in the repair of Owner's vehicle; however, notwithstanding the foregoing, Seller shall warranty its labor for a period of ninety (90) days next following the date of such repair.

- <u>Disclaimer for Parts.</u> Any warranties on the product sold hereby are those made by the manufacturer. Seller disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of the parts.
- 3. <u>Parts Return Policy</u>. Special order electrical parts require a deposit and are not returnable. All returnable parts are subject to the manufacturer's warranty and a fifteen percent (15%) restocking charge. All claims for returned parts must be accompanied by the purchase invoice. No refund after 30 days. Seller is not responsible for labor on parts not installed by in Seller's shop. We hereby certify that all parts were produced in compliance with all applicable requirements of sections 6, 7, and 12 of the Fair Labor Standards Act of 1938, as amended, and of regulations and orders of the administrator of wage and hour division issued under section 14 thereof.
- 4. <u>Terms.</u> Strictly cash unless arrangements made. Open account terms: Net 10th prox. All invoices remaining unpaid 30 days from the date of statement they appear on are subject to late charge of 1-1/2% per month.
- 5. <u>Mechanic's Lien Notice</u>. Failure to pay invoice places any vehicles worked on subject to repossession under §9.609, Texas Business and Commerce Code.

AUTHORIZED BY:		DATE:		
PRINT:	EMAIL:	maintenance@royal3inc.com	-CASH	SALE

GRAND TOTALS BELOW

SHOP SUPPLIES

MISC SUPPLIES

TAX

TOTAL

LABOR

PARTS

MISC

SUBLET

SUBTOTAL

ESTIMATED

BILLED

\$1,520.00

\$766.98

\$50.00

\$0.00

\$2,336.98

\$233.93

\$196.03

\$2,766.94

\$0.00