

DRIVER/VEHICLE EXAMINATION REPORT



Arizona Department of Public Safety
ADOT Enforcement and Compliance Division
P.O. Box 2100 Mail Drop EF-01
Phoenix, AZ 85005-2100
Phone: 602-712-6209
Email/Web: returndvr@azdps.gov

Report Number: AZXB56740216
Inspection Date: 05/27/2024
Start: 11:47 AM MST End: 01:02 PM MST
Inspection Level: I
HM Inspection Type: None

RIKI TRANSPORTATION INC
8225 LECLAIRE AVE
BURBANK, IL, 60459
dba: BRZ
USDOT#: 3119062
MC/MX#:
State#:
Phone#: 7083035150
Fax#:

Driver: Lindley, Antonio, Marquez
License# 056041951
State# GA
Date of Birth# 12/30/1991
CoDriver:
License#
State#
Date of Birth#

Location: San Simon POE WB
MilePost: 383
Highway: I-10 WB
County: COCHISE
Shipper: nrv packaging
Bill of Lading: y010
Origin: PULASKI, VA, US
Destination: NOGALES, AZ, US
Cargo: vehicle parts

VEHICLE IDENTIFICATION

Unit	Type	Make	Year	State	Plate #	Equipment ID	VIN	GVWR	Mileage	CVSA #	CVSA Issued #	OOS Sticker
1	TT	MACK	2023	IL	P1066194	856	1M1AN4GY0PM031938	53,200			34006496	
2	ST	HYTR	2024	TN	419070T	PTLZ242130	3H3V532K1RS118185	68,000				42724b2

BRAKE MEASUREMENTS

Steer Axle	Yes	No	No	No	No
Chamber	Disc	Disc	Disc	CLAMP - 30- E	CLAMP - 30- E
Right	N/A	N/A	N/A	INOP *	INOP *
Axle	1	2	3	4	5
Left	N/A	N/A	N/A	INOP *	INOP *

VIOLATIONS ATTRIBUTABLE TO THE MOTOR CARRIER

Vio Code	Section	Unit	OOS	Citation #	Verify	Violations Discovered
393.41-BNPB-SPR	393.41	2	N		N	Brake - Inoperative or missing power unit spring brake: Axle 4 right side is inop, no movement in push rod on brake application.
393.43D-BIPBS	393.43(d)	2	N		N	Brake - Inoperative or missing trailer Spring Brake: Axle 5 left side is inop, no movement in push rod on brake application.
393.43D-BIPBS	393.43(d)	2	N		N	Brake - Inoperative or missing trailer Spring Brake: Axle 4 left side is inop, no movement in push rod on brake application.
393.43D-BIPBS	393.43(d)	2	N		N	Brake - Inoperative or missing trailer Spring Brake: Axle 5 right side is inop, no movement in push rod on brake application.
393.75A3-TAOL	393.75(a)(3)	2	Y		N	Tires - All others, leaking or inflation less than 50% of the maximum inflation pressure: Axle 4 right side inside tire is off the bead, no measurable air in tire.
393.78A-WS	393.78(a)	1	N		N	Washers - Inoperative washing system. : No water to windshield on demand
396.3A1-BOS	396.3(a)(1)	2	Y		N	Brake - Defective brake(s) are equal to or greater than 20% of the service brakes on the vehicle/combination: Axle and 5 right and left have no movement in push rod when brakes are applied. More than 20% of brakes inop.

Report Prepared By:
OFC M. Huffaker (ADOT)

Badge #: Radio #:
XB5674 XB5674

Copy Received By:
ANTONIO MARQUEZ LINDLE...

Page 1 of 2



3119062 AZ AZXB56740216

DRIVER/VEHICLE EXAMINATION REPORT



Arizona Department of Public Safety
 ADOT Enforcement and Compliance Division
 P.O. Box 2100 Mail Drop EF-01
 Phoenix, AZ 85005-2100
 Phone: 602-712-6209
 Email/Web: returndver@azdps.gov

Report Number: AZXB56740216
 Inspection Date: 05/27/2024
 Start: 11:47 AM MST End: 01:02 PM MST
 Inspection Level: I
 HM Inspection Type: None

RIKI TRANSPORTATION INC
 8225 LECLAIRE AVE
 BURBANK, IL, 60459
 dba: BRZ
 USDOT#: 3119062
 MC/MX#: _____
 State#: _____
 Phone#: 7083035150
 Fax#: _____

Driver: Lindley, Antonio, Marquez
 License# 056041951
 State# GA
 Date of Birth# 12/30/1991
 CoDriver: _____
 License# _____
 State# _____
 Date of Birth# _____

Location: San Simon POE WB
 MilePost: 383
 Highway: I-10 WB
 County: COCHISE
 Shipper: nrv packaging
 Bill of Lading: y010
 Origin: PULASKI, VA, US
 Destination: NOGALES, AZ, US
 Cargo: vehicle parts

Special Checks:

E-Screen, Size and weight

* Pursuant to the authority contained in ARS 28-5204, I hereby declare vehicles with defects followed by a "Y" in the OOS column of the Violations section of this report to be OUT OF SERVICE. No person shall remove the Out of Service stickers applied to these vehicles, or operate such vehicles until the Out of Service defects have been repaired and the vehicles have been restored to safe operating conditions. Driver's initials: AL

The undersigned certifies that all violations noted on this report have been corrected and action has been taken to assure compliance with the Federal Motor Carrier Safety and Hazardous Materials Regulations insofar as they are applicable to motor carriers and drivers. False certifications of the required repairs are required to be prosecuted with penalties up to \$10,000.


Signature Of Repairer X: 7114#276 Facility: _____ Date: _____

NOTE TO DRIVER: This report must be furnished to the motor carrier whose name appears at the top of this report. If there are no vehicle violations on this inspection, it does not need to be signed and returned to the inspecting state. Keep the inspection on file at the business.

NOTE TO MOTOR CARRIERS: **** WARNING ***** If this box is checked (), a separate traffic citation was issued to the violator. Please refer to the issued traffic citation for additional information. This is in addition to any action required by this report. DRIVER & MOTOR CARRIER: This report must be furnished to the above named motor carrier. The motor carrier shall sign below and return, by mail or email, within 15 days to: Arizona Department of Public Safety Commercial Vehicle Enforcement Bureau PO Box 18410 Phoenix, Arizona 85005-8410 Email: returndver@azdps.gov The undersigned certifies that all violations noted on this report have been corrected and action has been taken to assure compliance with the Federal Motor Carrier Safety and Hazardous Material Regulations as adopted by Arizona Revised Statutes 28-5204 insofar as they are applicable to motor carriers and drivers. Violations, other than OOS conditions, detected during the inspection process will not preclude the completion of the current trip or dispatch. However, such violations must be corrected or repaired prior to re-dispatch.

Signature Of Motor Carrier Official X: [Signature] Date: 12/10/24

Other Driver / Carrier Notifications

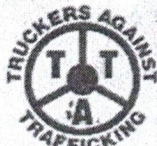

TRUCKERS AGAINST TRAFFICKING --- If you suspect human trafficking, please contact 9-1-1 and call the National Human Trafficking Hotline at 1-888-373-7888. Make the call, save lives! Go to <https://truckersagainstrafficking.org/> to learn more.

Report Prepared By:
 OFC M. Huffaker (ADOT)

Badge #: Radio #:
 XB5674 XB5674

Copy Received By:
 ANTONIO MARQUEZ LINDLE...

Page 2 of 2



3119062 AZ AZXB56740216